




MSS DATA
SOLUTIONS

FCAT Pre-Polished Connector: Installation Instructions



1 Assembly Components


SC/PC SM

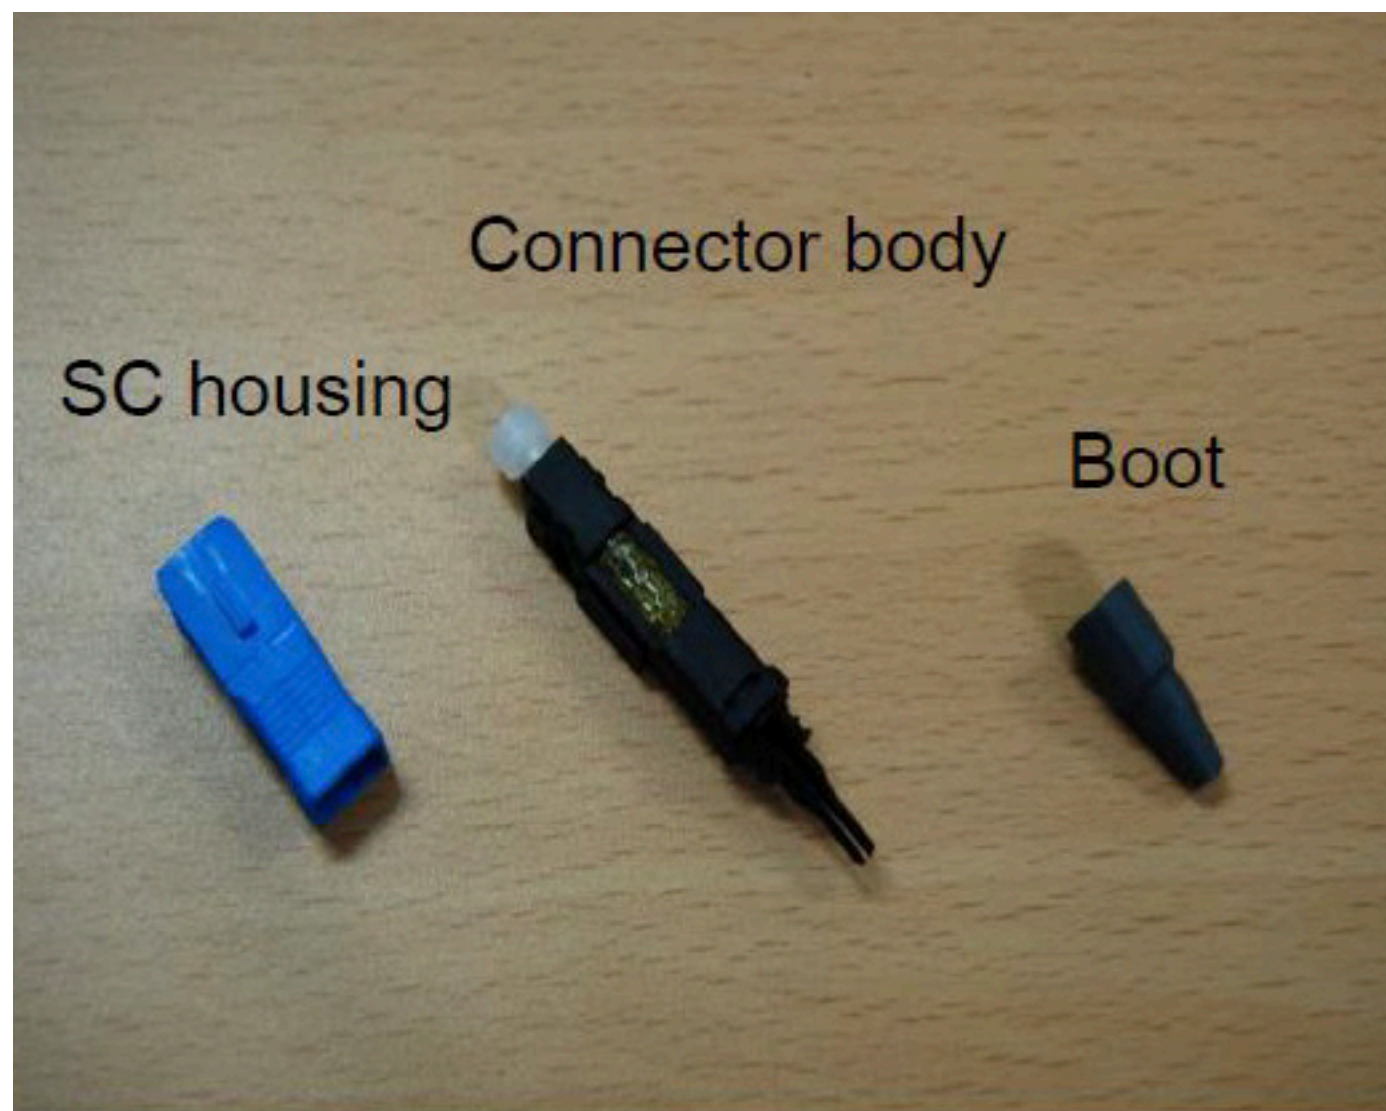

SC/APC SM





2 Assembly Tools

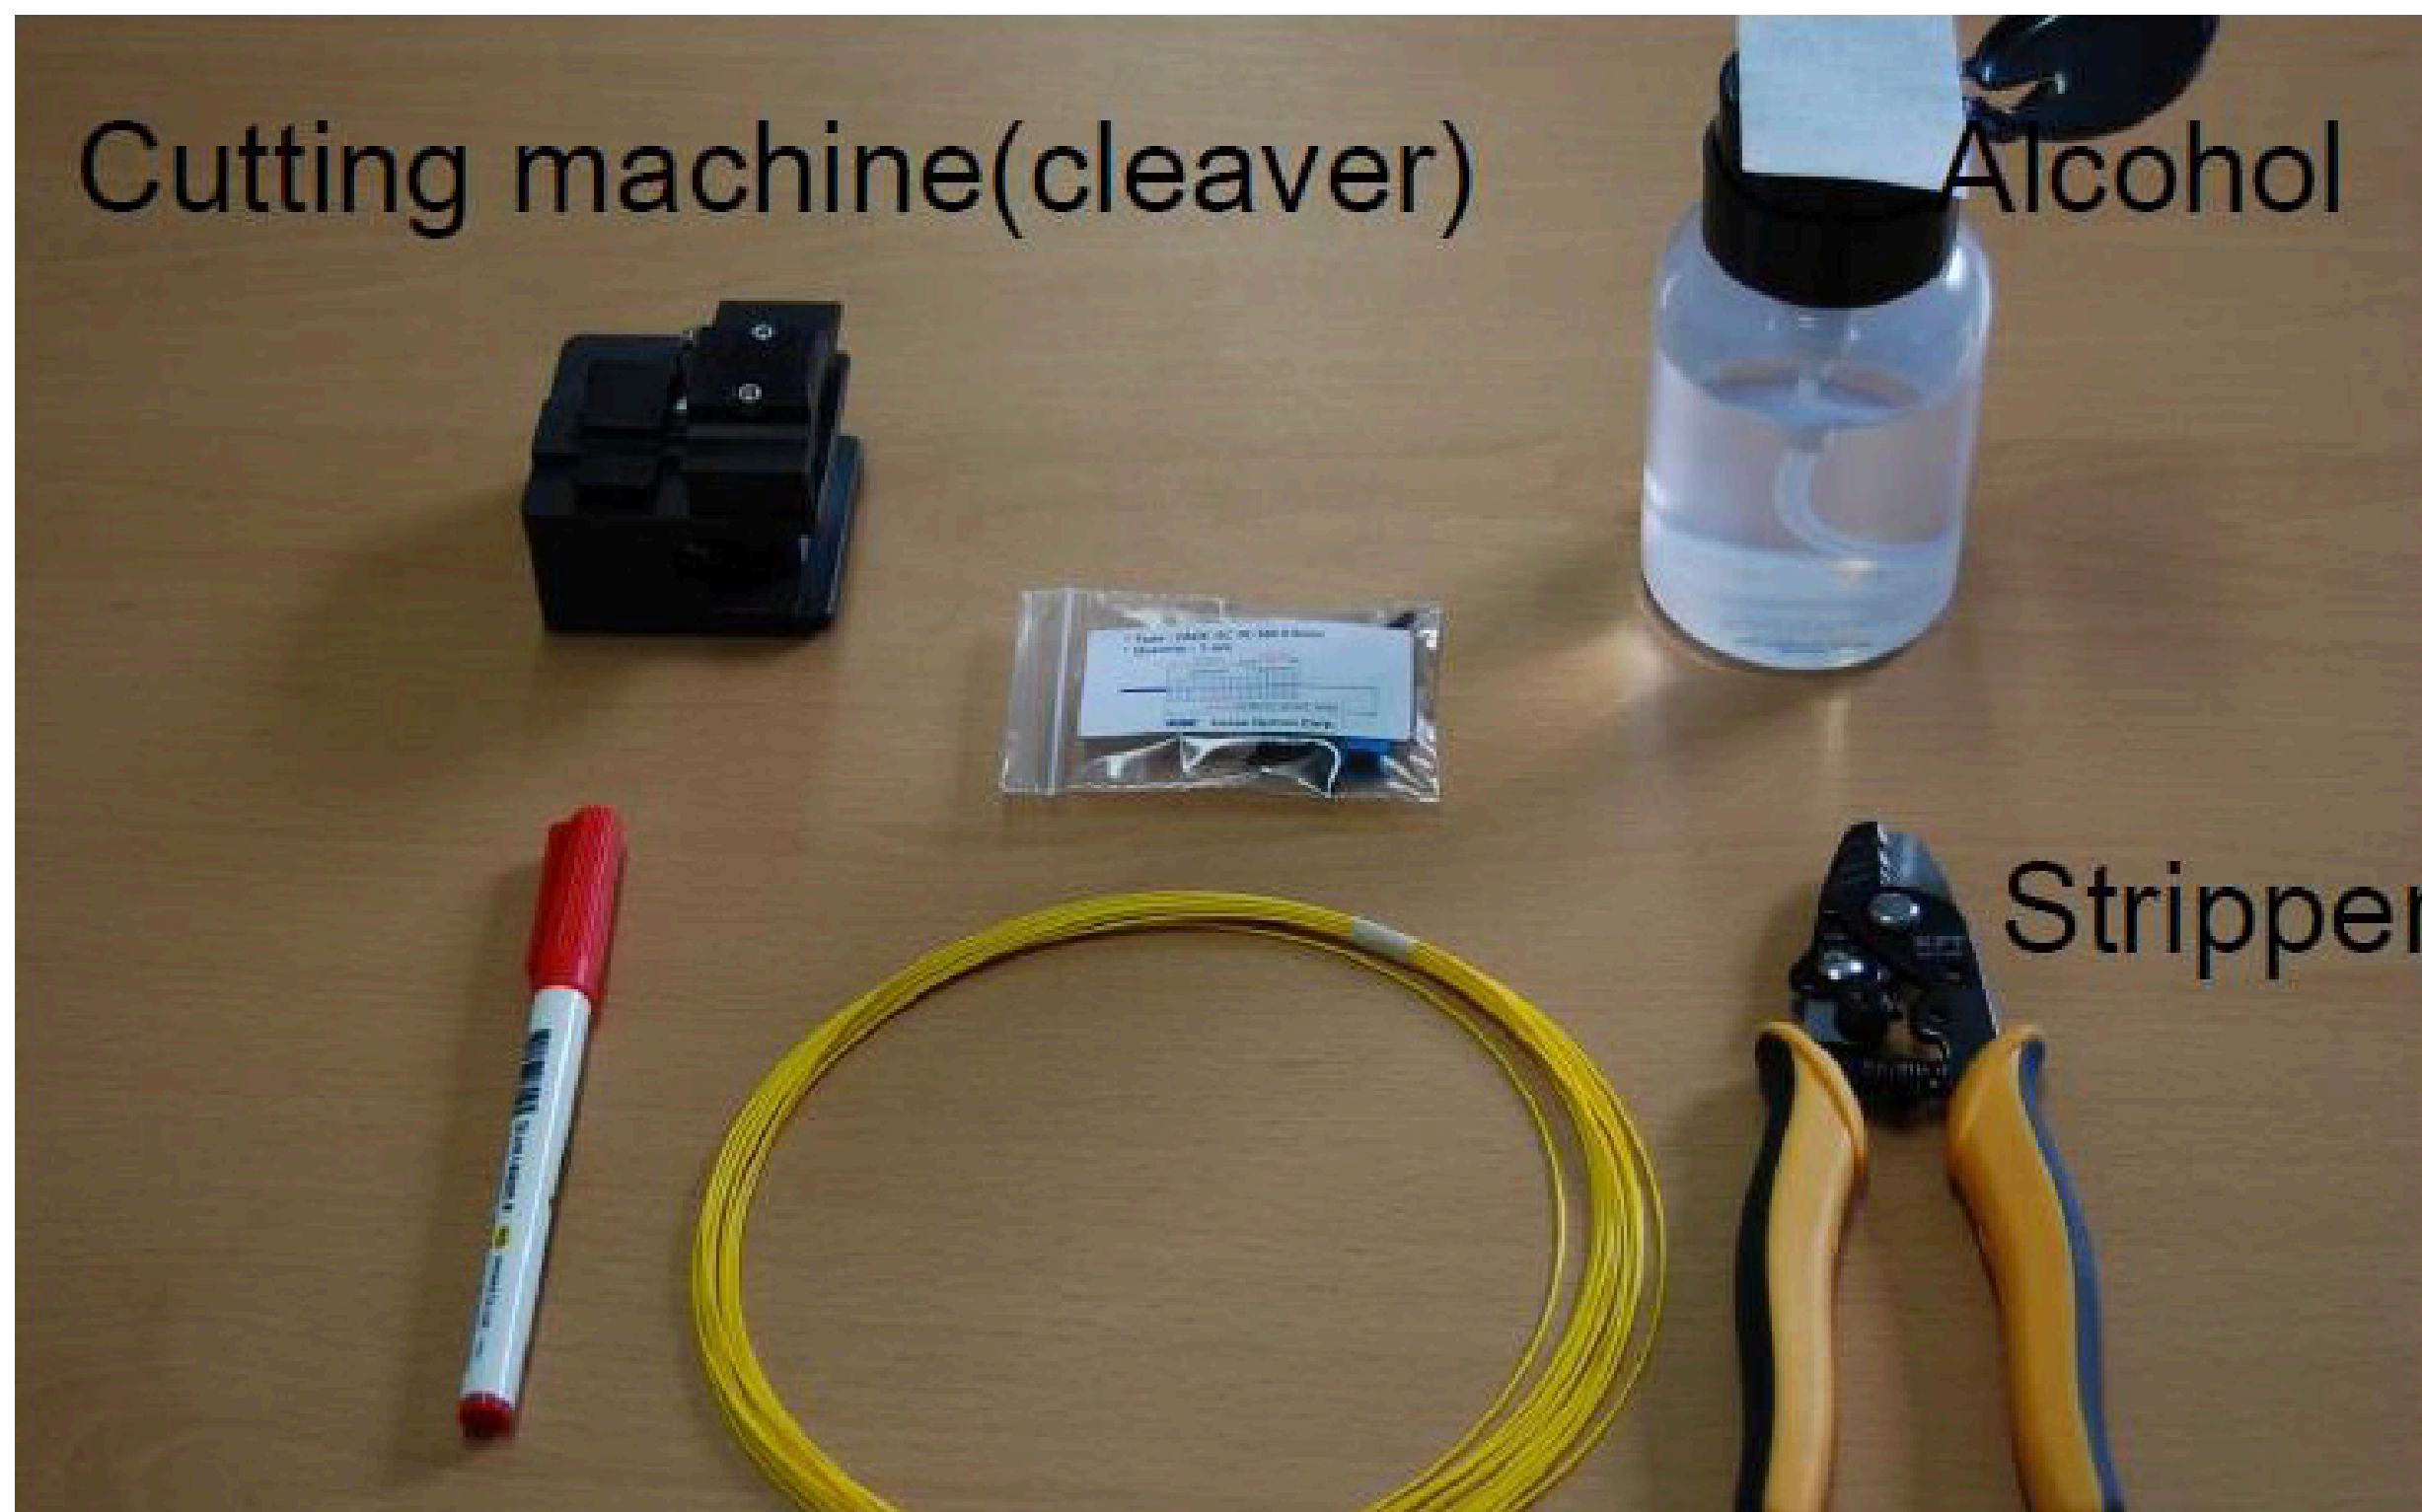

3 Assembly Procedure

Step 1



- A. Insert the boot on the 900um tight buffer fibre.
- B. Strip off the buffer so that there is 5cm or more exposed.

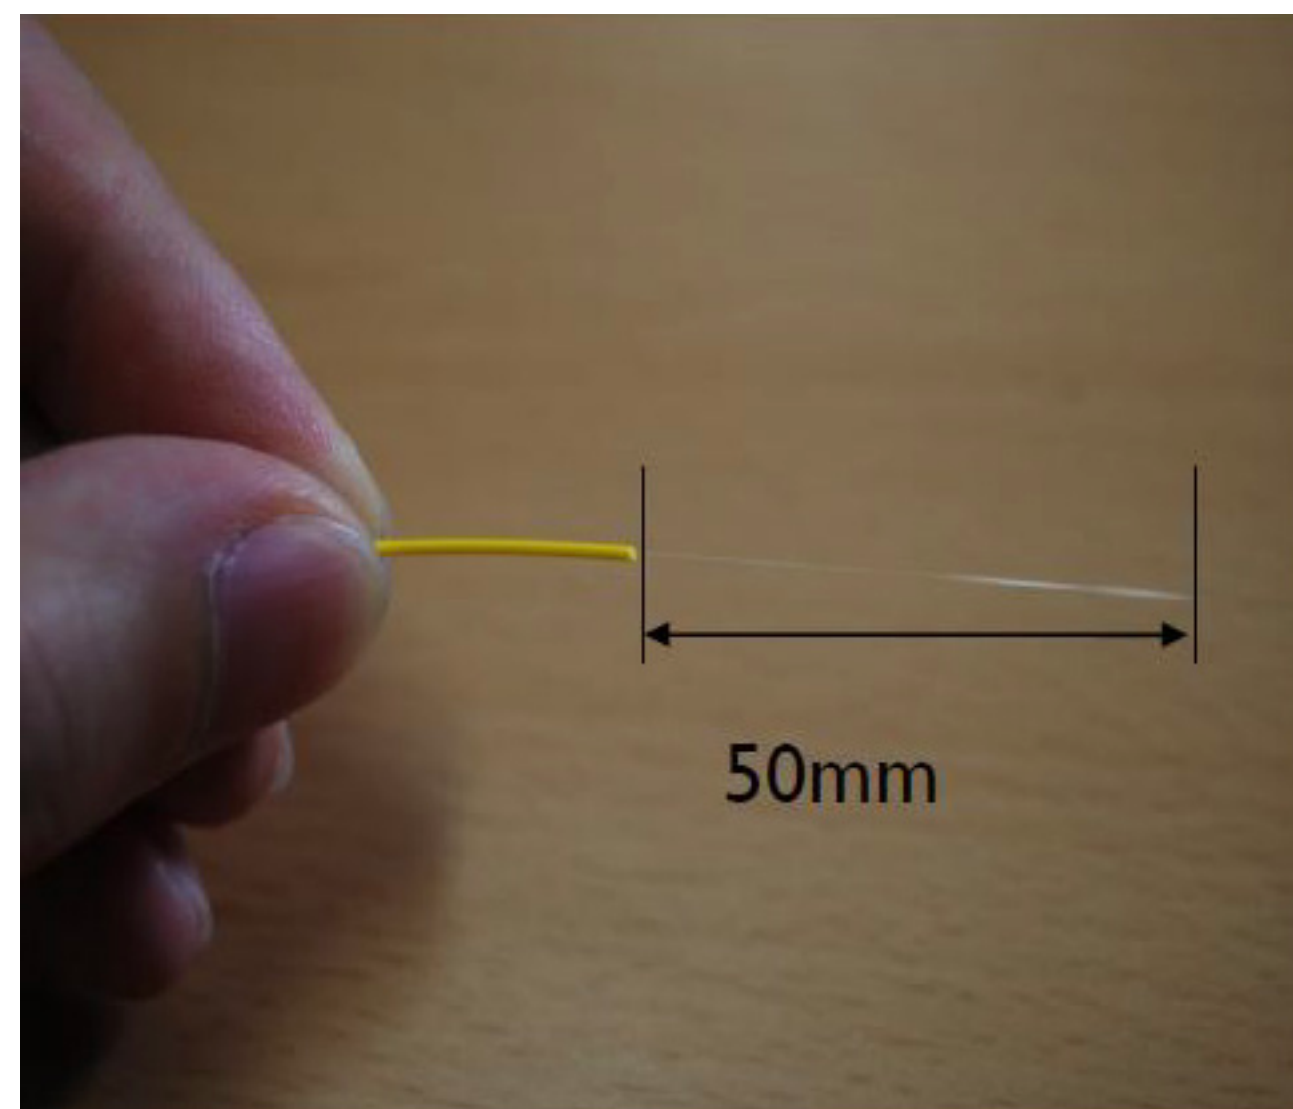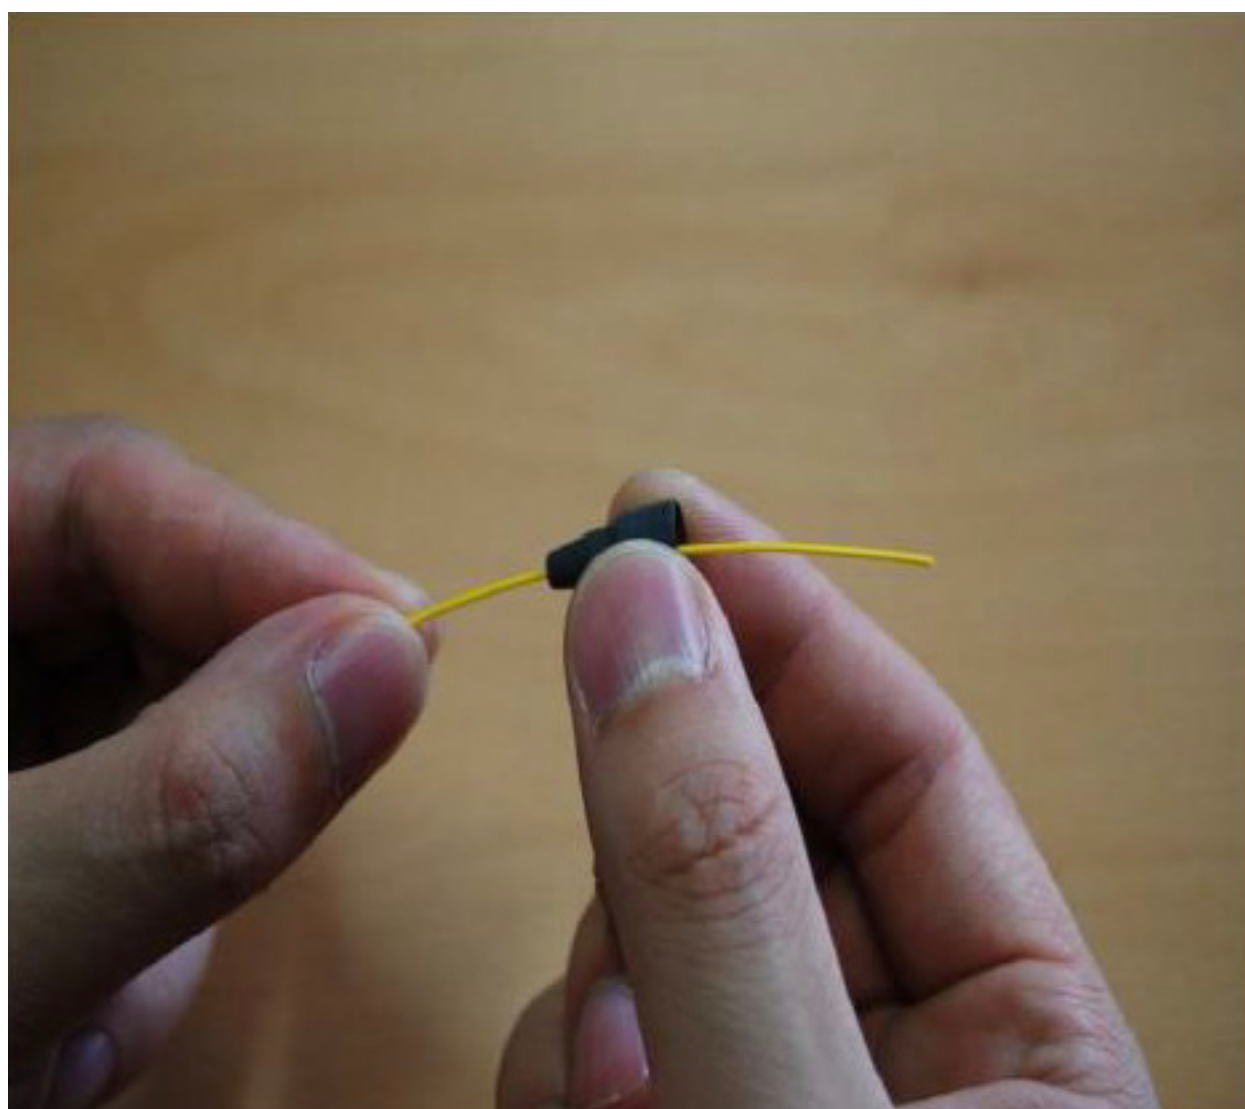

3 Assembly Procedure

Step 2



- A.** Mark with a pen on the 250um coating, 18mm from the 900um buffer.
- B.** Strip off the 250um coating from the end of the fibre, leaving 18mm of 900um buffer.
- C.** Wipe clean with alcohol wipe

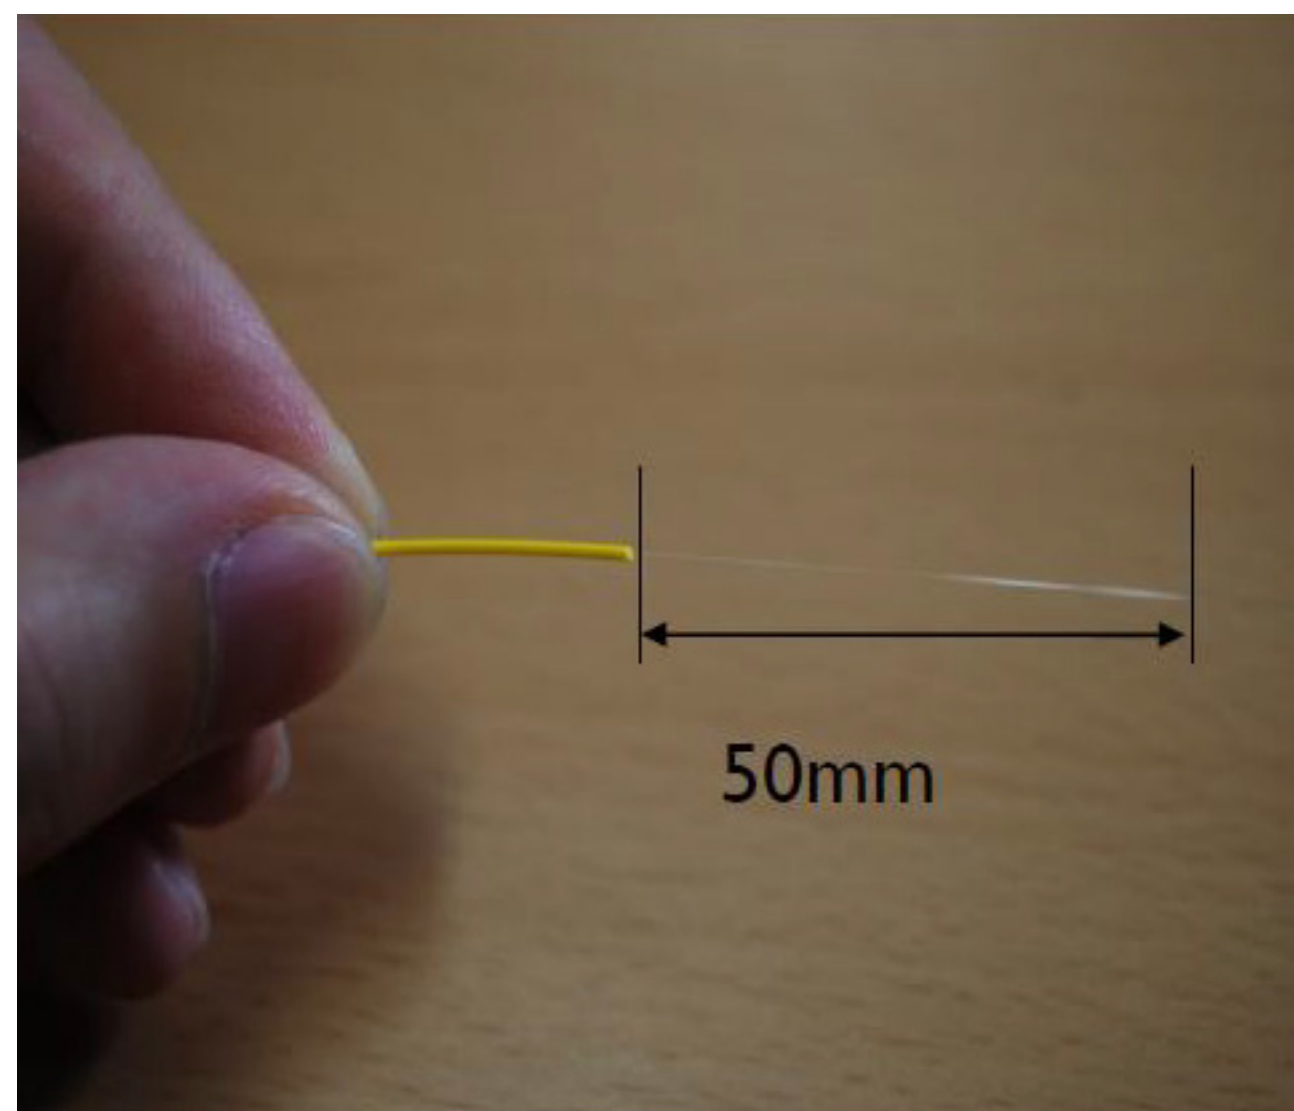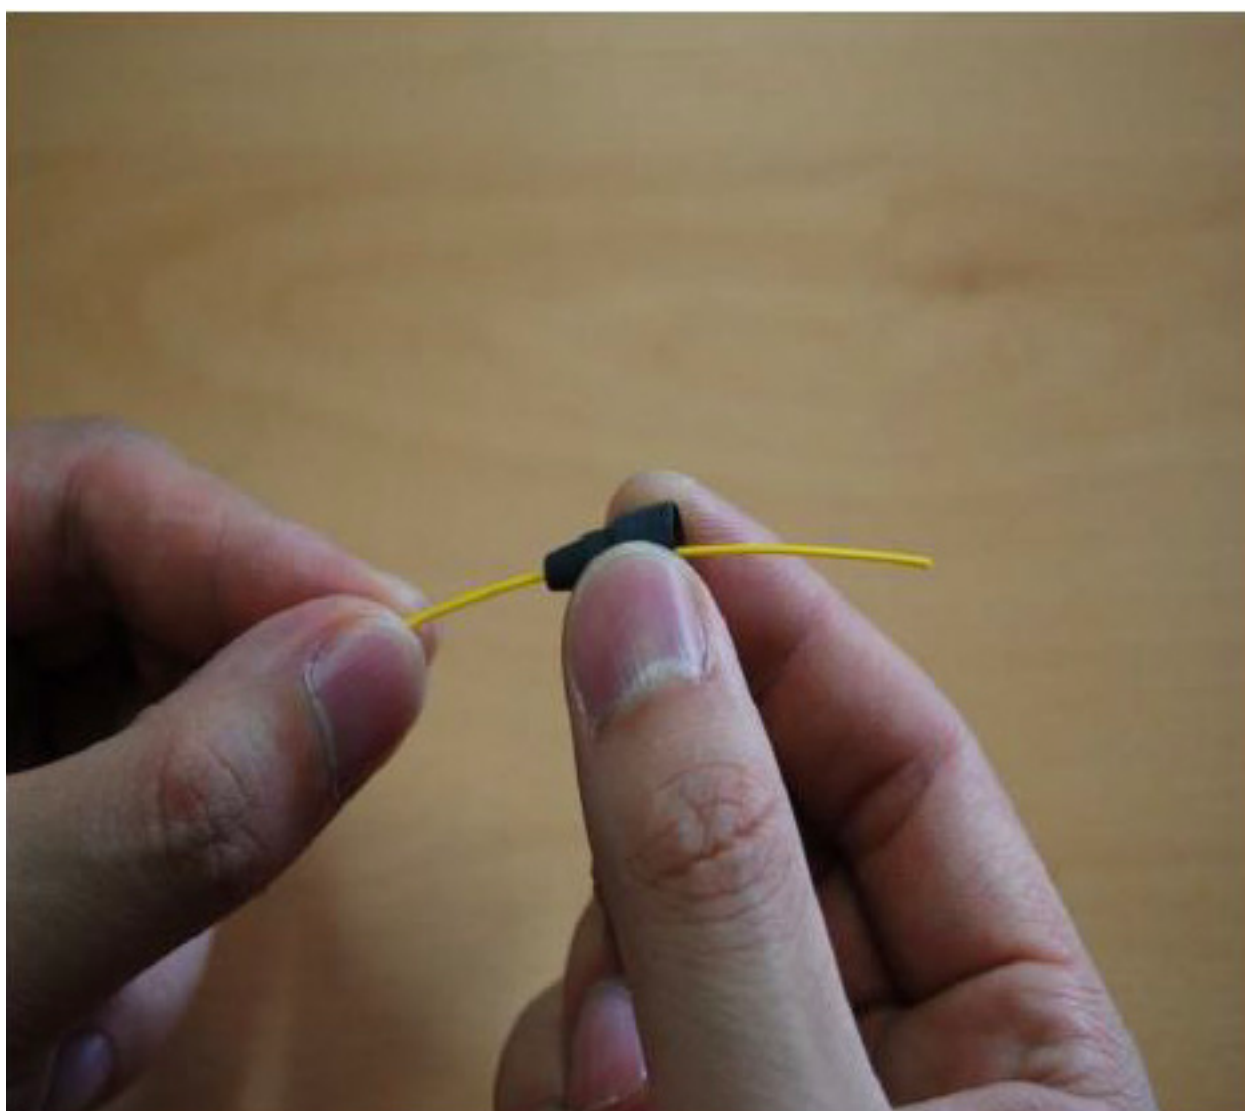

3 Assembly Procedure

Step 4


A. Insert the fibre in the connector body through the fibre guide so it has a slight bend to maintain pressure and keep it in position.

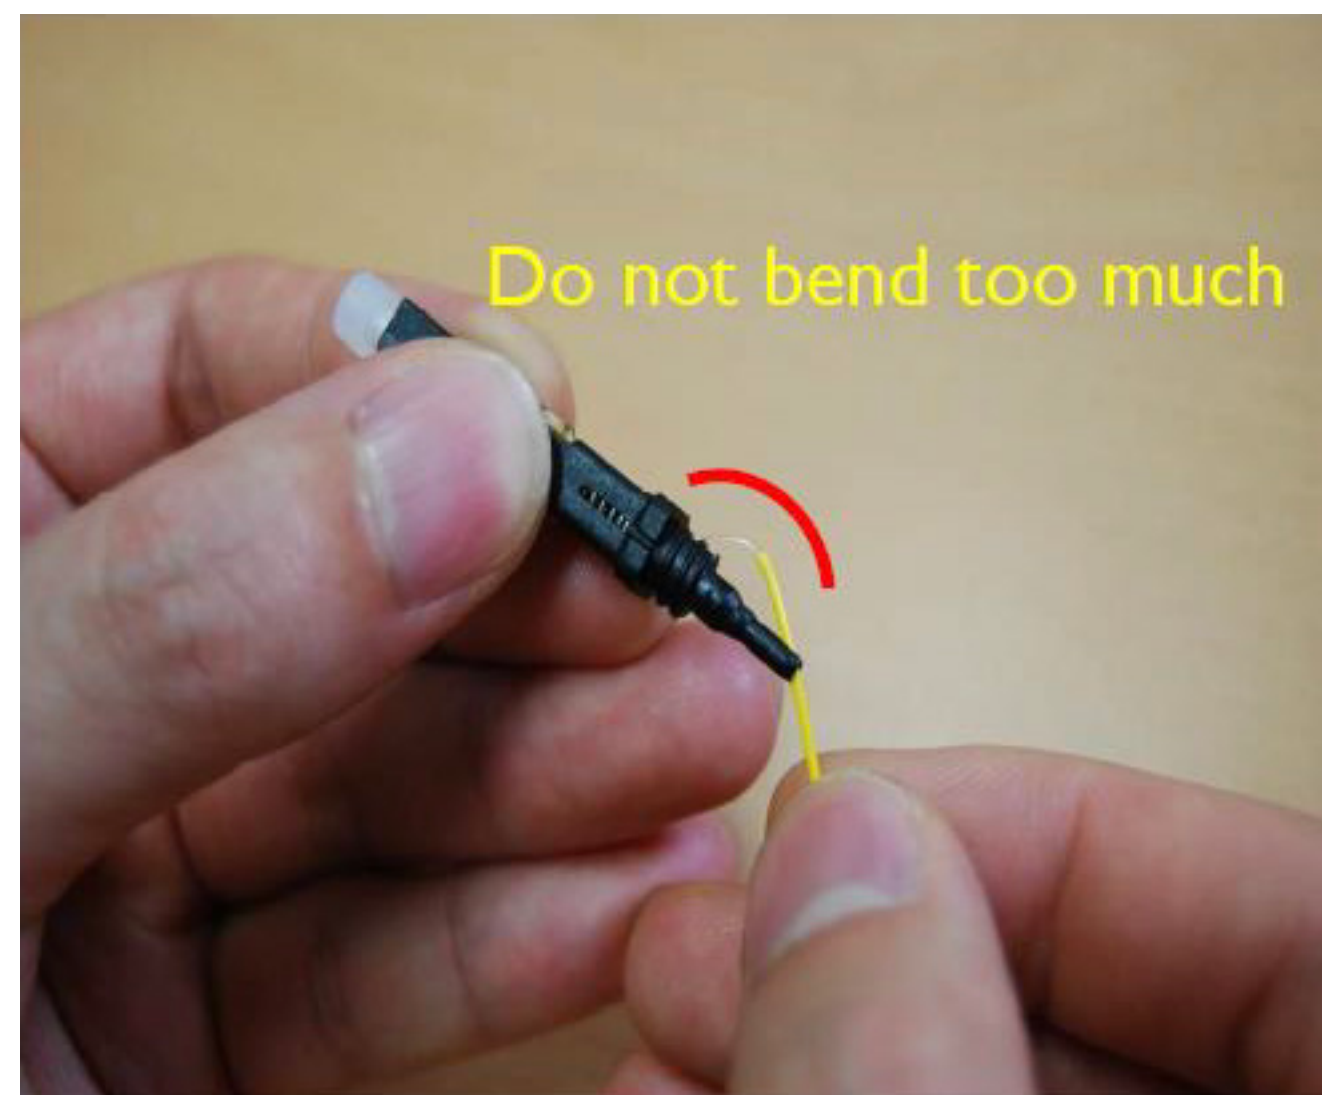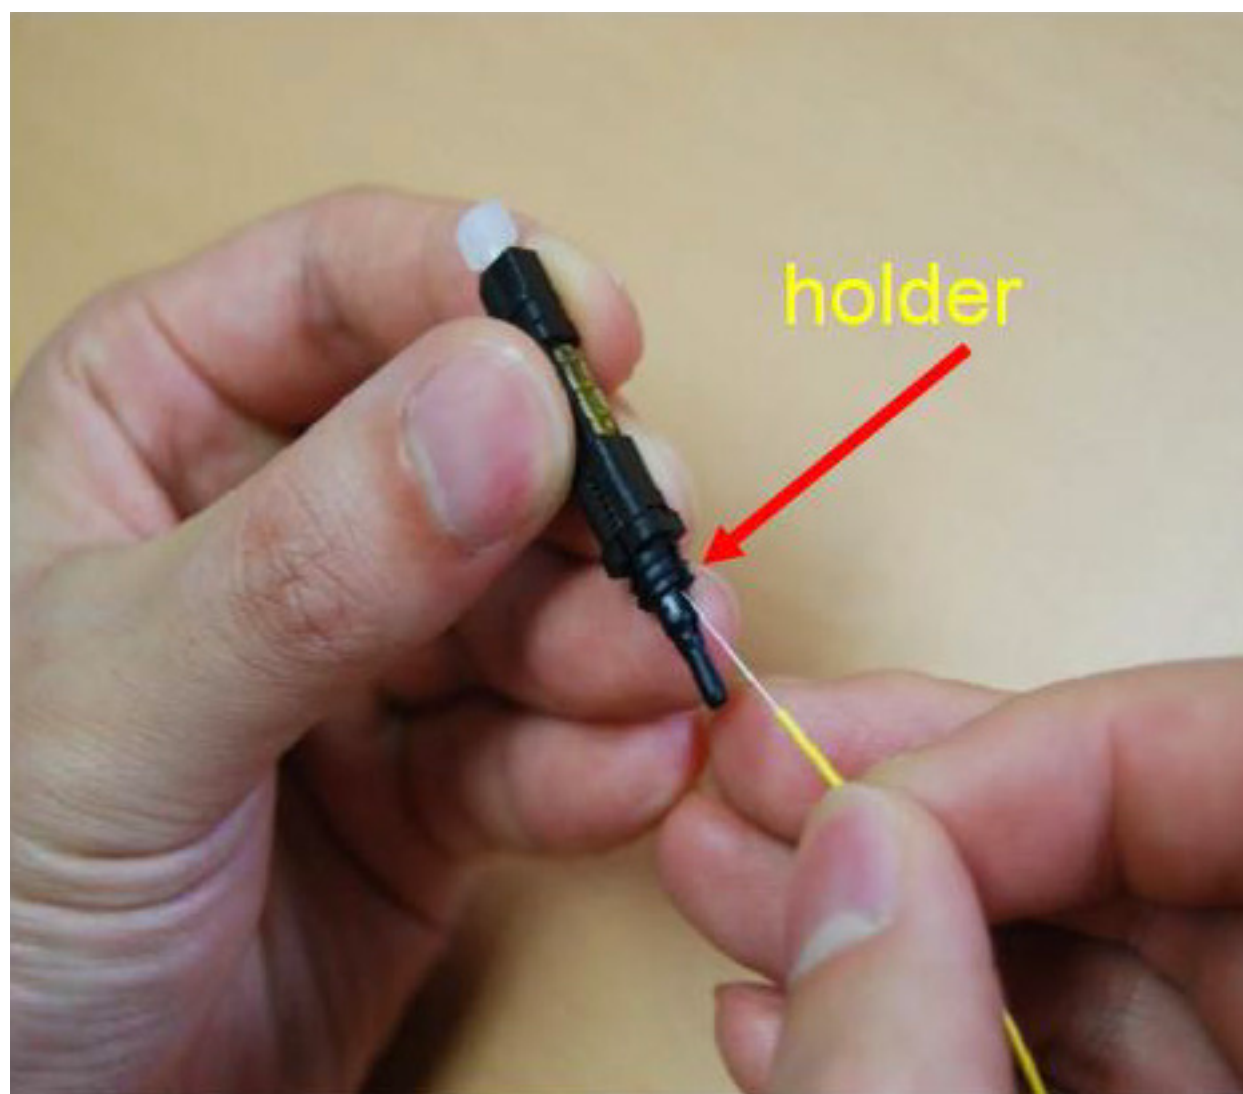

3 Assembly Procedure

Step 5

A. Remove the Black Clip.

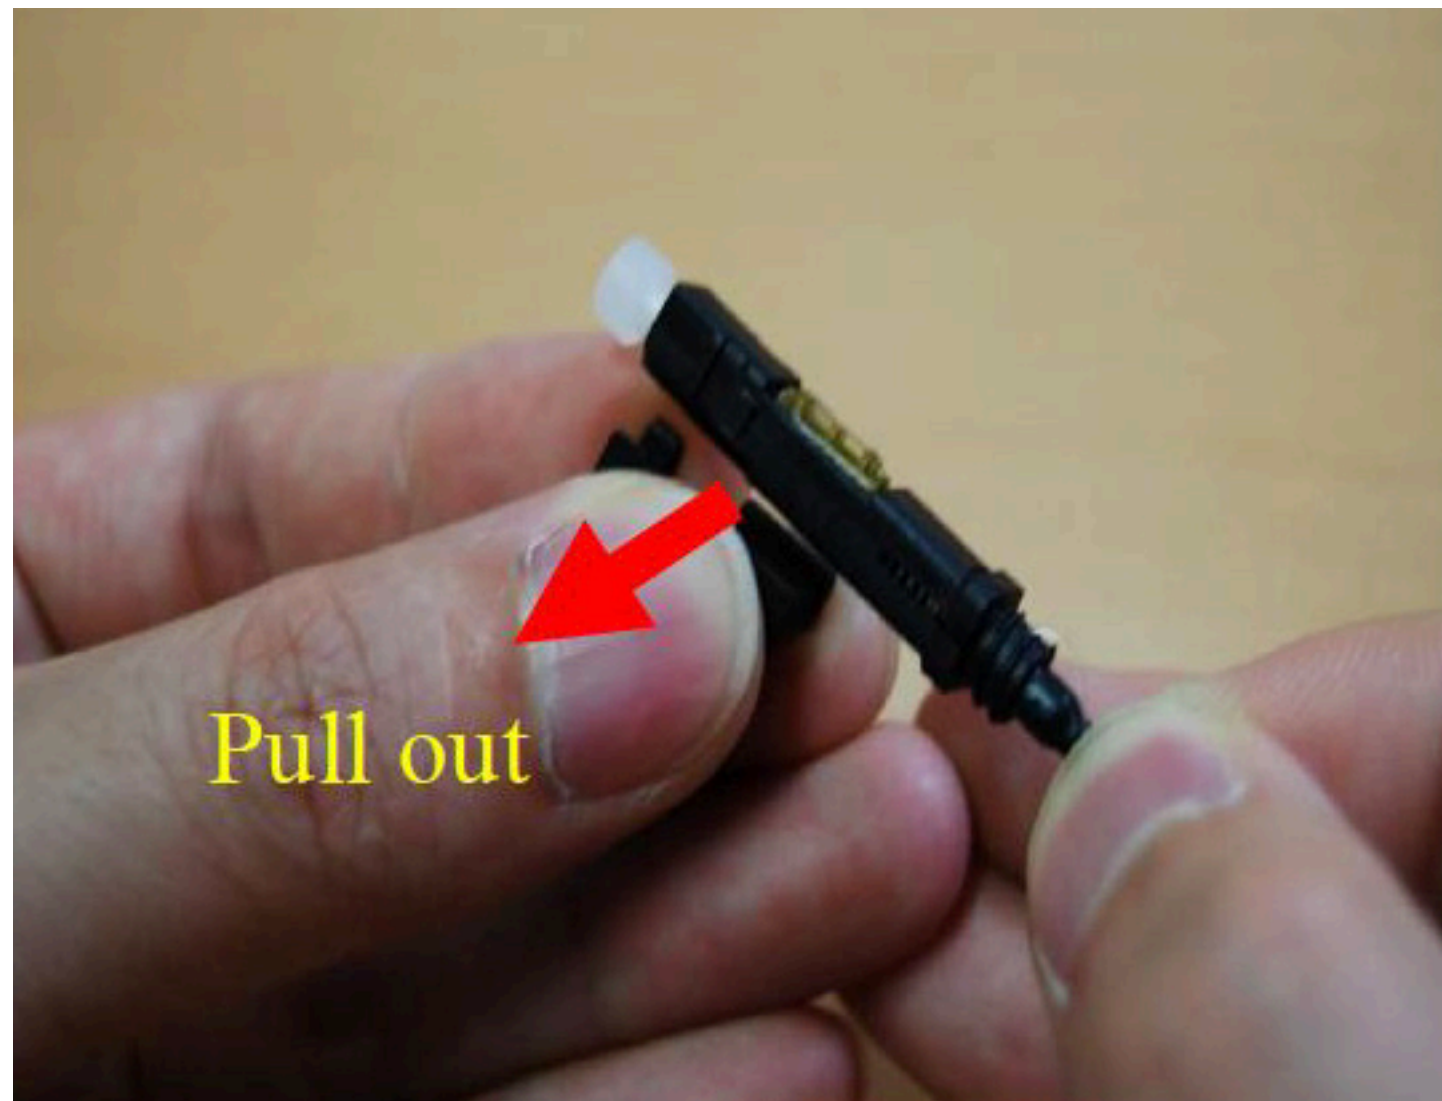

3 Assembly Procedure

Step 6

- A.** Press the centre of the yellow button while maintaining enough pressure on the fibre for it to bend slightly.
- B.** Release the pressure, pull the cable back enough so it can be inserted into the guide (i.e. slot).





3 Assembly Procedure

Step 7

A. Tighten the boot.

B. Insert into coloured housing.

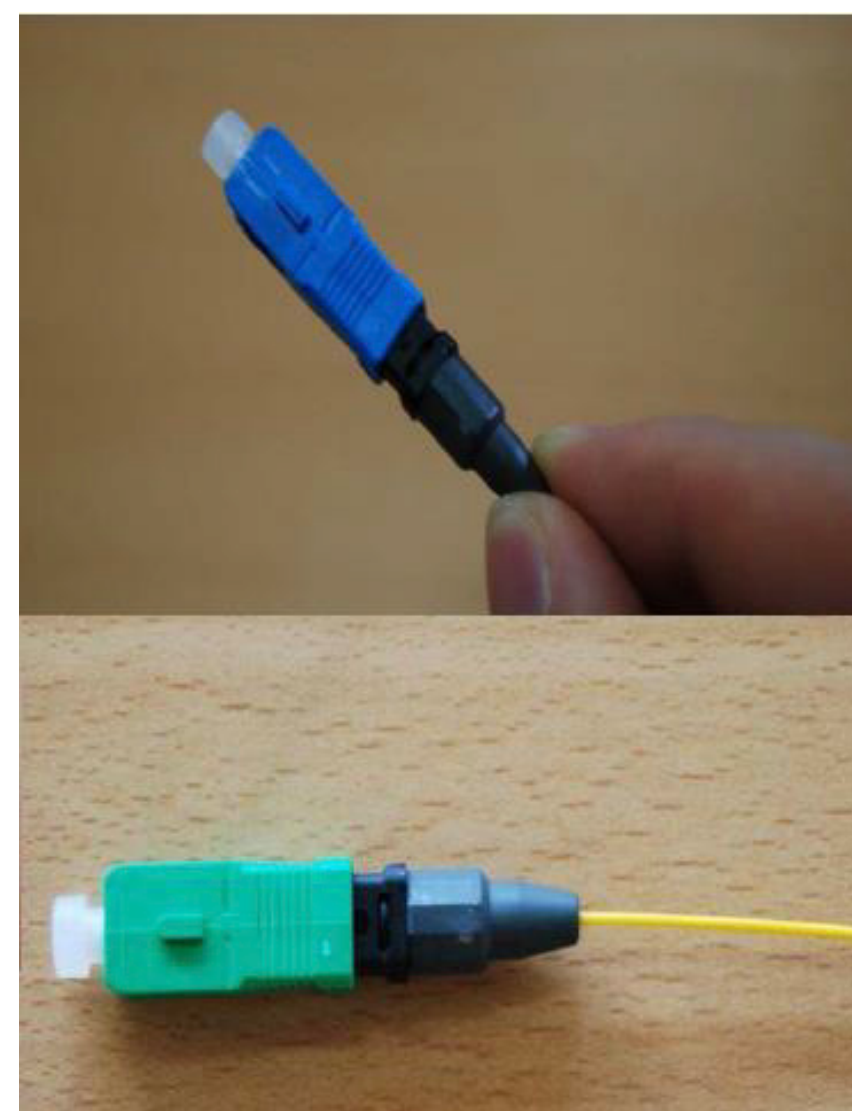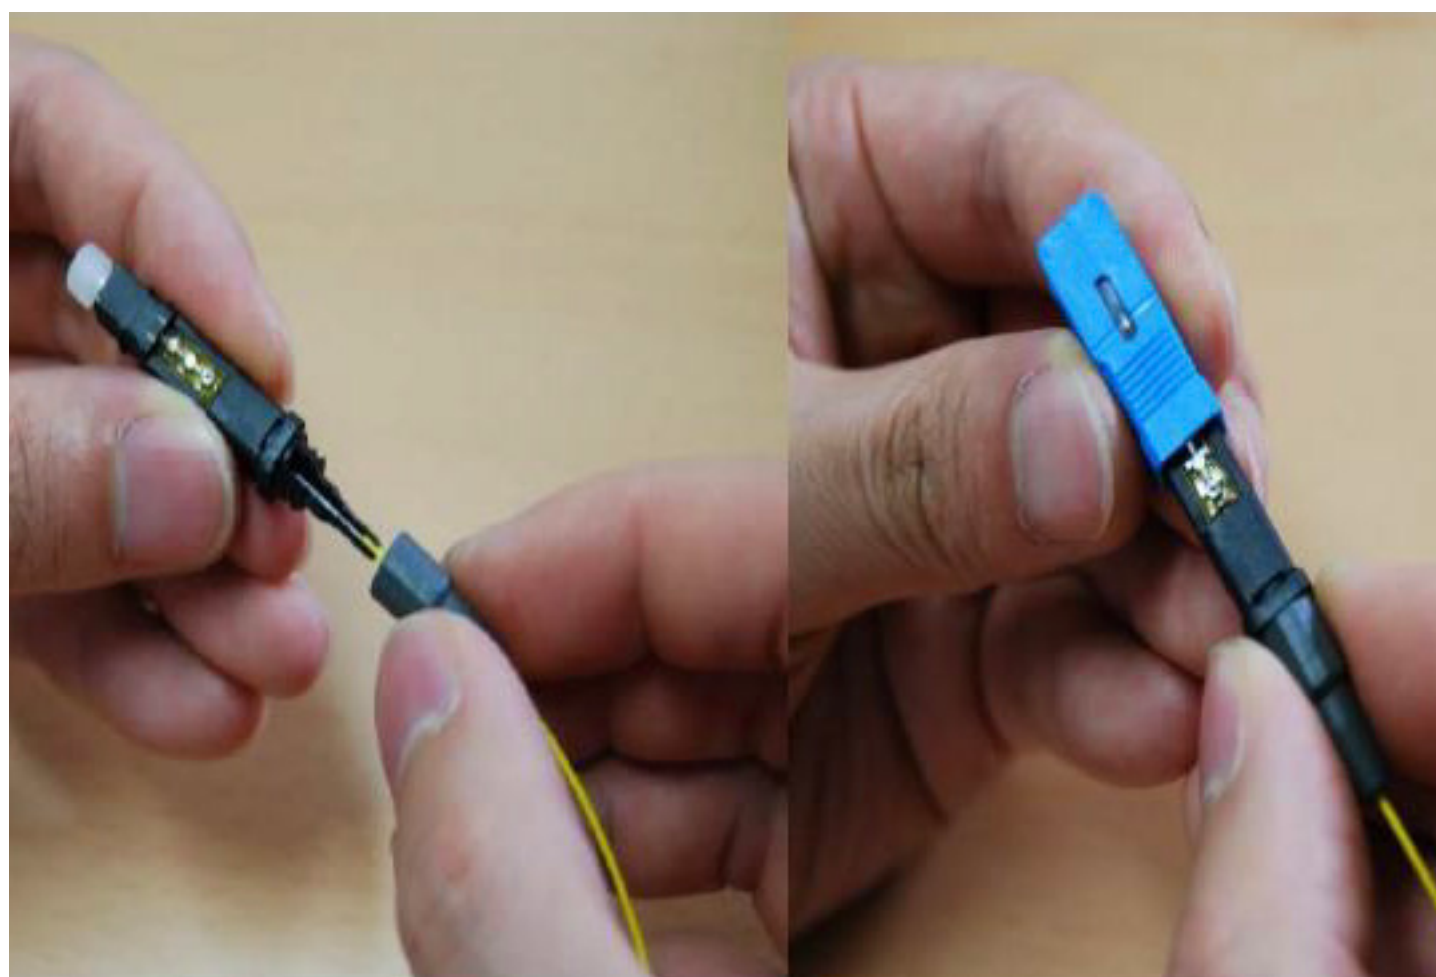


1 Disassembly Procedure

Step 1

A. With the dust cap on, hold the coloured housing as shown below and push down onto a hard surface.

B. Unscrew the boot.

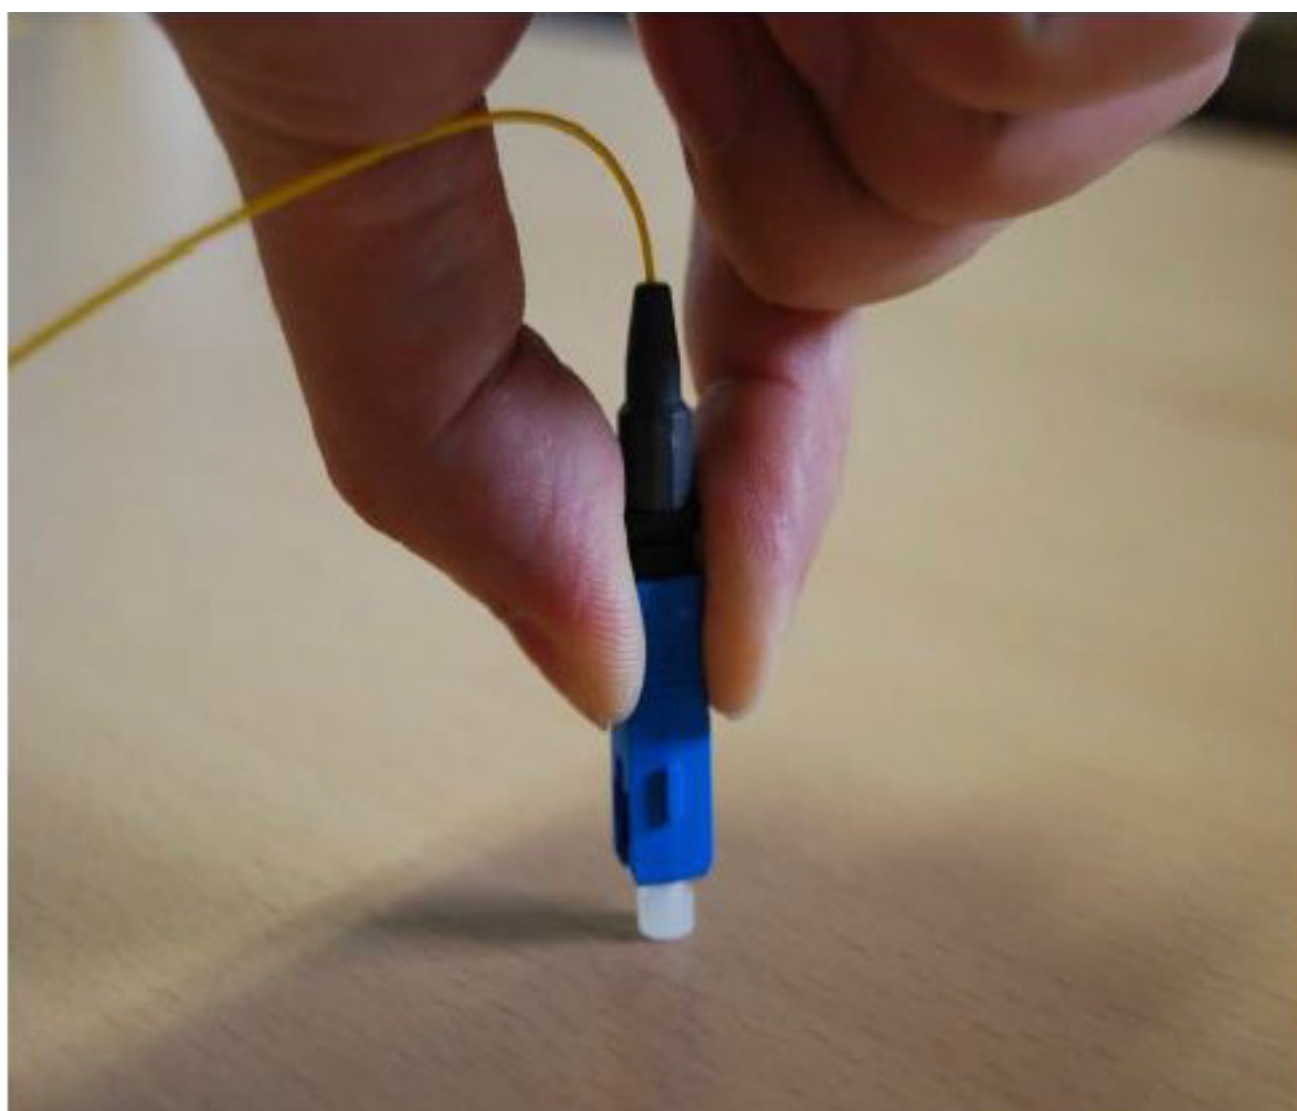

1 Disassembly Procedure

Step 2

- A. Press the black clip back onto the connector body.
- B. Remove the fibre from the connector.

